## Panasonic Canada Inc.

5770 Ambler Drive Mississauga ON L4W 2T3

## Tech Tips

Product: PLASMA TV	Models: TH42PX60	Number: TT-08-14
Code: B62	Model Year: 2006	Date: February 26, 2008


PCB Designation: D Board

Part #: TNPA3810AHS

**Symptom:** Picture disappears after few minutes but sound is OK.

Cause: Low Ldo\_5V supply to IC9800 (DC to DC Converter) due to leaky D9801.

**Remedy:** Replace D9801 on the D board.

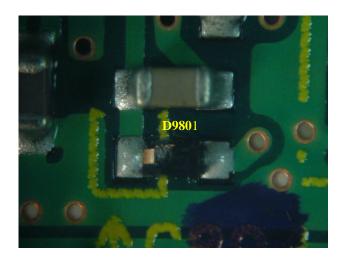

## Parts list

D9801:

Part # - B0JCDD000002